

VOLVO PENTA

Volvo Penta of the Americas
1300 Volvo Penta Drive
Chesapeake, Virginia 23320-9810

Service Bulletin

Group	Number	Version
21-3	17	02

Drive Couplers

All Gasoline Sterndrive Engine Models

Distribution: M

Date: 12-2006

Binder: C

Serial Number Range

4012192604 through 4012202457

Information

It has been reported to Volvo Penta that in a few instances an engine vibration can be detected between 800 and 850 rpm with drive in gear. The cause has been determined as improper machining of the mounting face of the drive coupler.

If this issue is encountered, replace the drive coupler with a service replacement drive coupler from Volvo Penta Parts as follows:

3.0L: #3854032

4.3L, 5.0L, 5.7L: #3858437

8.1L: #3853962

Warranty Claim Information

For drive coupler replacement submit Volvo Warranty claim as instructed below:

Warranty Type: 31 - Product Warranty

Failed Part Number: 3.0L #3854032
4.3L, 5.0L, 5.7L #3858437
8.1L #3853962

Reason Code: 56

Flat Rate Labor Code: 21682 Drive Coupler, R&R 1.0 Hrs
20012 Engine, Stern Drive R&R. (3.0L) 3.5Hrs., (4.3-8.1), 4.5Hrs.
44102 Drive R&R 1.0Hrs.
20009 Test Run After Repair 0.3 Hrs.

Parts Used in the Repair: 3.0L #3854032 Drive Coupler Qty: 1
4.3L, 5.0L, 5.7L #3858437 Drive Coupler Qty: 1
8.1L #3853962 Drive Coupler Qty: 1

