

# VOLVO PENTA

Volvo Penta of the Americas  
1300 Volvo Penta Drive  
Chesapeake, Virginia 23320-9810  
USA

## Service Bulletin

Group	Number	Version
<b>22-0</b>	<b>20</b>	<b>01</b>

### Dipstick


Models  
DPX500, DPX600

Distribution: M

Date: 03-2001

Binder: C

A small number of these engines were produced with factory altered engine oil dipsticks. These dipsticks can be identified using the illustration below. The same part number, 3850474 is stamped on both parts. If you need to replace one of these altered dipsticks order part number 3861782. The "ADD" and "SAFE" marks have been moved to the back of the altered dipstick (3861782).

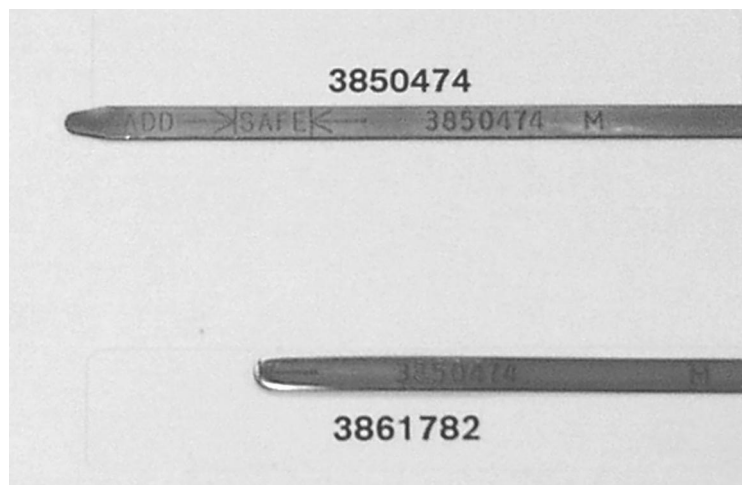

NOTE: It is always important to insure that the engine crankcase is filled with the correct quantity of oil. The crankcase capacity of these engines is 7.5 liters or 8 quarts (8.5 liters or 9 quarts with filter change). If there is doubt concerning the accuracy of the dipstick, completely empty the crankcase and refill with the correct quantity of oil. If the engine has an un-altered dipstick, 3850474 and the dipstick reads as significantly too full after the refill, replace the dipstick with the 3861782 part. If the engine has an altered dipstick, 3861782 and the dipstick reads as significantly under-filled after the refill, replace the dipstick with the 3850474 part.

